


# MetPrep Preparation Procedure – No 42

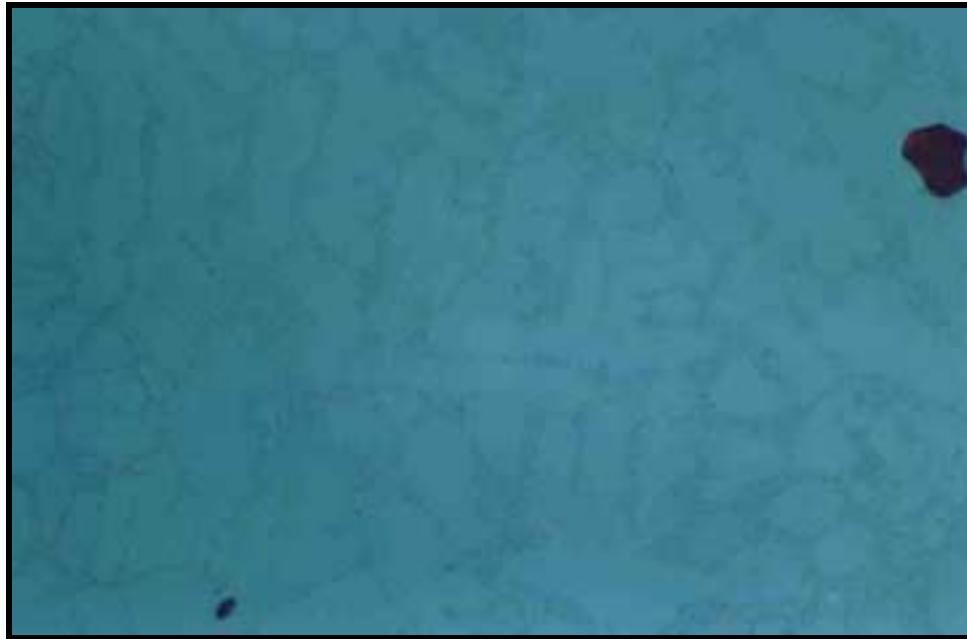

## Chill Cast Tough Pitch Copper

	Surface	Abrasive	Pressure		Speed – Dir	Time
Primary Grinding Stage	Paper	P240g SiC	Psi	N	150 – Comp	Until Planar
			5	25		

	Surface	Abrasive	Pressure		Speed – Dir	Time
Additional Grinding Stages	Planocloth H	9 $\mu\text{m}$ (WB) Diamond	Psi	N	250 – Comp	5 mins
			5	25		
	Durasilk	3 $\mu\text{m}$ (WB) Diamond	5	25	250 – Comp	4 mins

	Surface	Abrasive	Pressure		Speed – Dir	Time
Polishing Stage	Multicloth	0.06 $\mu\text{m}$ Silco	Psi	N	80 – Comp	2 mins
			3	15		